


**HARDWARE REQUIRED  
(Without Spares)**

- (8) 1/2" Anchor Shackles
- (10) 5/8" Anchor Shackles
- (4) 3/4" Anchor Shackles
- (1) 7/8" Anchor Shackle
- (1) Edgetech Release Link
- (3) 1/2" Sling Links
- (11) 3/4" Sling Links
- (4) 3/8" Screw Pins
- (1) 1" Screw Pin

FOR ALL \*  
Label cable \_\_m  
from upper swage.  
Clearly mark upper  
swage as "TOP".

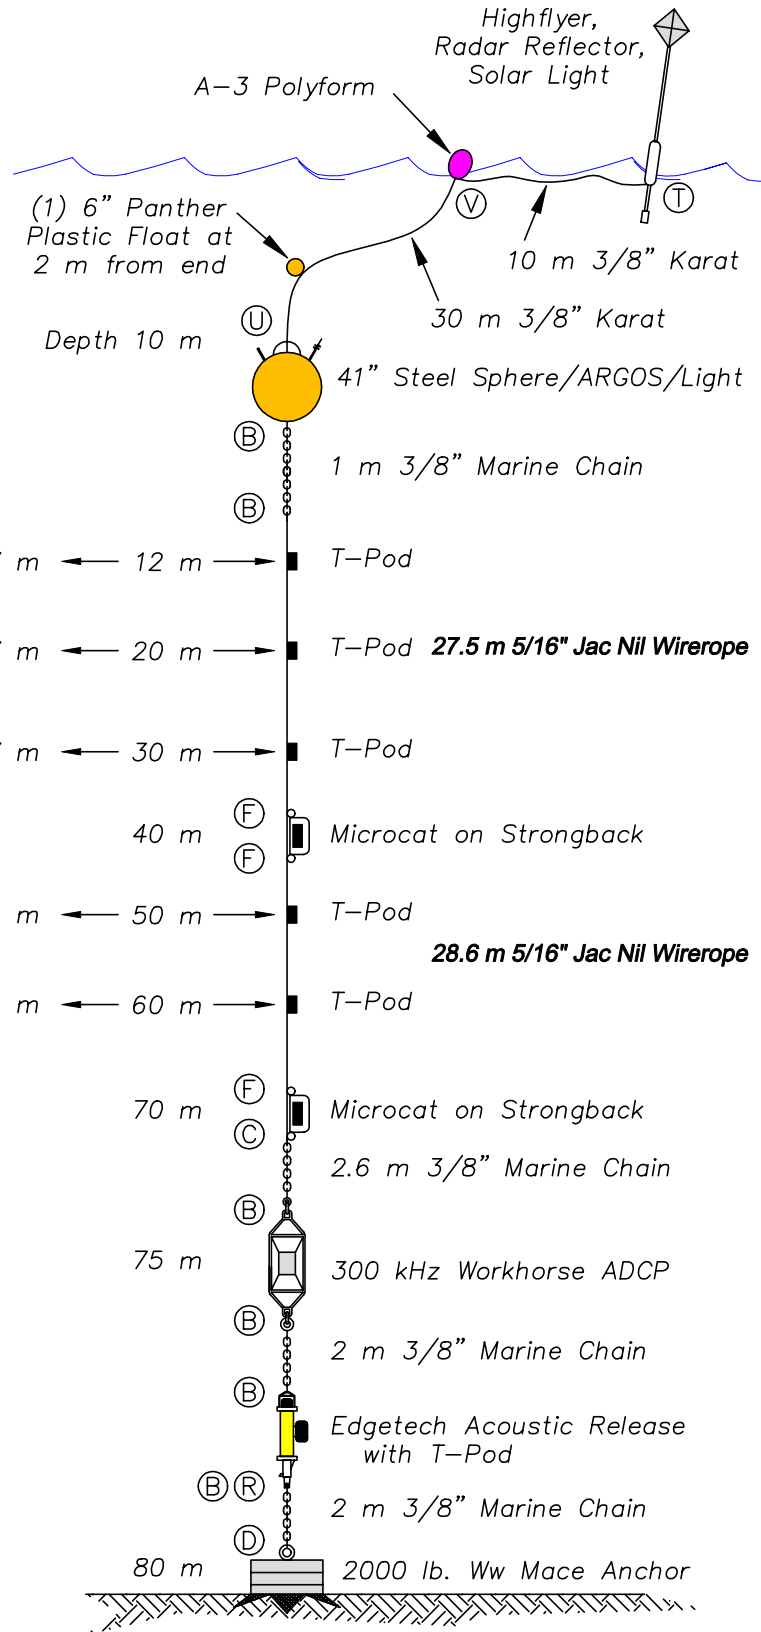

HARDWARE DESIGNATION	
(A)	(2) 1/2" SH, (1) 3/4" SL
(B)	(1) 1/2" SH, (1) 3/4" SL, (1) 5/8" SH
(C)	(1) 1/2" SH, (1) 3/4" SL, (1) 3/4" SH
(D)	(1) 1/2" SH, (1) 3/4" SL, (1) 7/8" SH
(E)	(1) 5/8" SH, (1) 3/4" SL, (1) 3/4" SH
(R)	Release Link, Edgetech
(T)	(1) 3/8" Screw Pin
(U)	(1) 5/8" SH, (1) 1/2" SL, (1) 3/8" Screw Pin
(V)	1" Screw Pin, (2) 1/2" SL, (2) 3/8" Screw Pins

**ASIAEX 2001  
Environmental Mooring  
at 80 meters, near source**